

Troubleshooting Your Design with the TDS2000C Series Oscilloscopes



Table of Contents

Troubleshooting Your Design with the TDS2000C Series Oscilloscope	4
Getting Started	5
Capture Elusive Glitches and Anomalies	3-7
Debug Digital Timing Problems	8
Verify Timing Relationships	9
Check Signal Integrity	-11
Debugging Digital System Lock-up	12
Test for Presence of Video Signals	13
Look for Unintentional Circuit Noise	-15
Power Line Harmonic Analysis16-	-17
Automatically Capture and Save Elusive Waveform Anomalies	18
Make a Quick Pass/Fail Test of Your Device	19
Documenting Your Results with OpenChoice® Software	20
Waveform Measurements Logging	21
Waveform Analysis using NI SignalExpress [™] Tektronix Edition	22

Troubleshooting Your Design with the TDS2000C Series Oscilloscope

Today's engineers and technicians face increasingly complex and critical troubleshooting tasks. New digital designs often challenge designers with new problems to find: race conditions, transients, signal aberrations, bus contention problems, etc. And, of course, competitive time-to-market pressures dictate that troubleshooting must be completed quickly and accurately.

The TDS2000C Series delivers the performance, affordability and portability that enable engineers and technicians to tackle these challenges – quickly and easily. More than just a matter of basic bandwidth, these oscilloscopes enable users to solve problems quickly, helping them to establish that a problem exists, allowing them to capture the problem accurately, and enabling them to analyze it to determine the root cause.


The tips on the following pages are designed to further simplify your troubleshooting tasks. But if you need more help, there is plenty available. Simply contact your local Tektronix representative, authorized distributor, or visit www.tektronix.com/oscilloscopes


- 50, 70, 100, and 200 MHz models
- Up to 2 GS/s sample rate on all channels
- Active TFT Color Display for easy viewing at a distance, at an angle, or under dim lighting conditions
- Built-in USB host and device ports standard
- Easy documentation and analysis with PC connectivity software
- Lifetime warranty*


* Limitations apply. For terms and conditions, visit www.tektronix.com/lifetimewarranty

Getting Started

To optimize your troubleshooting task at hand, it is important to start at the beginning – with proper probe compensation and attenuation, default setup, and automatic instrument setup.

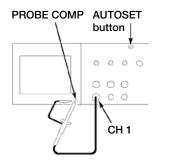

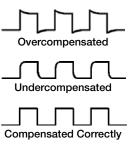

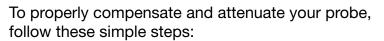


- 1. Connect the probe to channel 1.
- Attach the probe tip and reference lead to the PROBE COMP connectors. If using the probe hook-tip, ensure a proper connection by firmly twisting the tip onto the probe.

3. Push PROBE CHECK.

- 4. The oscilloscope will automatically check the probe attenuation and check the shape of the displayed waveform to determine if your probe is compensated correctly.
- 5. If necessary, it will instruct you to adjust your probe compensation.


To ensure that you begin with factory initialization settings, follow these simple steps:

- 1. Press the front panel **DEFAULT SETUP** button.
- 2. Press the front panel **AUTOSET** button.



Capture Elusive Glitches

In today's high-speed digital designs, elusive glitches and random anomalies can cause circuits to fail. While finding these glitches has never been easy, the TDS2000C Series simplifies this task with its

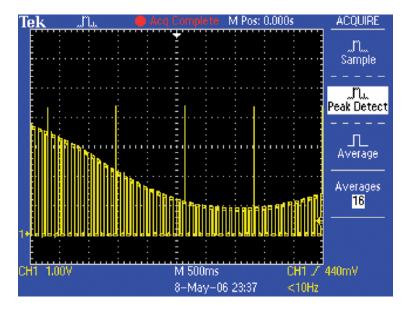

peak detect feature. Peak detect can capture narrow glitches, even on low-frequency signals.

To use the Peak Detect feature:

- 1. Display the waveform on the screen.
- 2. Press the **ACQUIRE** front panel menu button.
- 3. Press the Peak Detect menu button.
- 4. Notice that the oscilloscope captures several very narrow glitches, even at slow sweep speeds. Without peak detect, you would not have seen many of these glitches.

Capture Elusive Glitches (continued)

Intermittent signal anomalies can also be a challenge to see. The TDS2000C Series provides variable- and infinite-persistence display capabilities to provide you with information about the signal

M Pos: 0.000s DISPLAY Tek ..n.. Type Vectors Persist Infinite Format ΥT Contrast 50% CH1 / 480mV M 10.0ns CH1 500mV 8-May-06 23:29 8.42430MHz


variations over time, making it easier to understand the characteristics of the transients you've captured.

To use Display Persistence:

- 1. Display the waveform on the screen.
- 2. Press the **DISPLAY** front panel menu button.
- 3. Press the **Persist** menu button until the desired amount of persistence is selected.
- 4. Notice that the most recent signal is highlighted in the display. By monitoring the screen updates, you can judge the relative frequency-of-occurrence of the signal anomalies.

Debug Digital Timing Problems

Digital designers need to quickly find and analyze a wide range of circuit timing problems. For example, race conditions and transients can cause circuits to perform inaccurately. The TDS2000C Series'

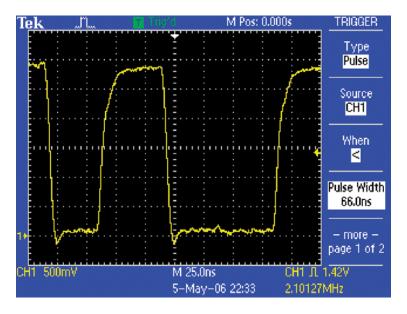


pulse width trigger can help troubleshoot such situations by triggering when a signal pulse width is less than, greater than, equal to or not equal to a specified pulse width.

To use the pulse width trigger:

- 1. Press the **TRIG MENU** front panel button.
- 2. In the side menu, press Type until Pulse is selected.
- 3. Press the **When** side menu button until < is selected.
- 4. Use the multipurpose knob to set the desired minimum pulse width.
- 5. Select, as desired, Source, Polarity, Mode, and Coupling.

Verify Timing Relationships

Electronics engineers often need to verify that their circuits are working as designed. One of the most common types of oscilloscope measurements is timing measurements, such as pulse

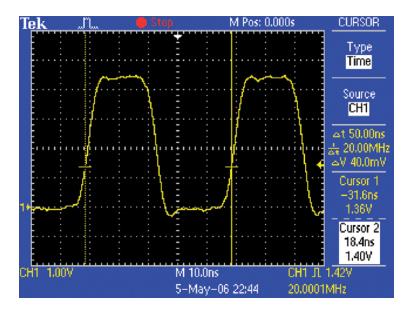


width, period, and frequency. The TDS2000C Series' cursors can be used to make such measurements quickly and easily.

To make timing measurements using cursors:

- 1. Press the **CURSOR** button.
- 2. Press the **Type** menu button until the **Time** cursor type is selected.
- 3. Press the Cursor 1 menu button.
- 4. To measure the timing relationship between two signals, place cursor 1 on the first edge of interest, using the multipurpose knob.
- 5. Press the **Cursor 2** button and place cursor 2 on the second edge of interest, at approximately the same Voltage.
- 6. The cursor readouts indicate the timing of the cursors relative to the trigger point. In this example, the Δt readout indicates the period of the waveform, and the $1/\Delta t$ is the frequency of the signal.

Check Signal Integrity

Electronics engineers may discover that a wide array of unintentional electrical events will make a difference in how circuits function in the real world. To characterize these events, engineers can measure

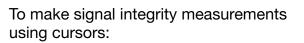

1. Press the **CURSOR** button.


used to make such measurements.

2. Press the **Type** menu button until the **Amplitude** cursor type is selected.

criteria such as overshoot, ringing, ground bounce, cross talk, and


other signal integrity issues. The TDS2000C Series' cursors can be

- 3. Press the Cursor 1 menu button.
- 4. To measure the peak ringing below ground, place cursor 1 at 0 Volts, using the multipurpose knob.
- 5. Press the **Cursor 2** menu button and place cursor 2 on the negative peak, using the multipurpose knob.
- 6. View the absolute Voltage measurements on the cursor readouts at the side of the display. The Δ readout indicates the difference between the cursor positions.

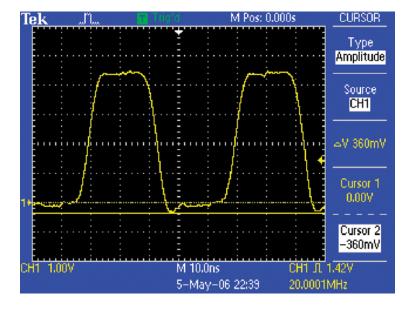

Check Signal Integrity (continued)

The TDS2000C Series' automatic measurement system can also be used to make such measurements quickly and automatically.

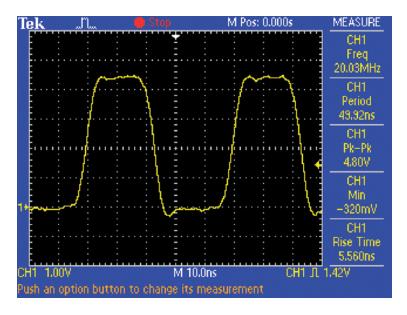


To make signal integrity measurements using automatic measurement system:

- 1. Press the **MEASURE** front panel button.
- 2. Press a **CH1** side menu button to add an automatic measurement.
- 3. Press the **Type** side menu button until you find the desired measurement, and then press **Back**.
- 4. Repeat steps 2 and 3 to select and display up to 5 measurements.
- 5. View the selected measurements on the right side of the display.

Debugging Digital System Lock-up


One common cause of digital system lock-ups is an intermittent clock. The TDS2000C Series trigger system can quickly and easily identify unexpected interruptions in the clock signal.

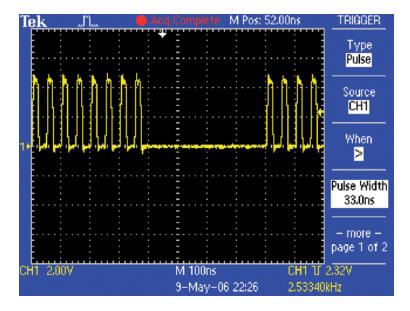

- 1. Press **TRIG MENU** front panel button.
- 2. Press **Type** side button until **Pulse** is selected.
- 3. Press **When** until **>** is selected.
- 4. Using the multipurpose knob, set **Pulse Width** to slightly longer than the clock pulse.
- 5. Press -more- and press Polarity until Negative is selected.
- 6. You can also adjust the **TRIGGER LEVEL** to capture lowamplitude or "runt" pulses.

Test For The Presence of Video Signals

Video technicians must perform a quick check for the presence of a video signal at different test points. If the site is in the field, technicians will need lightweight, portable test equipment gear that

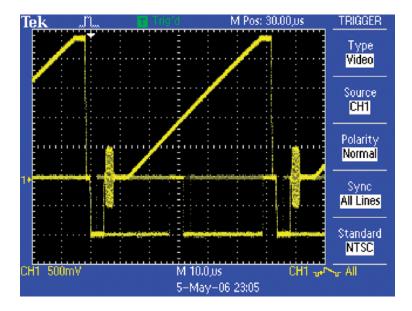


they can easily carry to each location. The TDS2000C Series' video trigger features make this oscilloscope a valuable tool for these technicians.

- 1. Connect the video signal to the oscilloscope using proper adapters and a 75 Ω terminator, if necessary.
- 2. Press the AUTOSET front panel button.
- 3. Press the **Line/Field** side button to select video line triggering. If a broadcast-standard video waveform is present, the oscilloscope will display a stable video waveform that is triggered on all lines.
- 4. To add some display persistence, press **DISPLAY** and press **Persist** to select the desired persistence.
- 5. Adjust vertical position and scale as desired.
- 6. To adjust trigger setup, press **TRIG MENU** and change **Source**, **Polarity**, and video **Standard**.
- 7. If desired, reconnect the oscilloscope to other test points. You do not need to change any oscilloscope settings.

Look for Unintentional Circuit Noise

Developers need to check for unintended noise in their prototypes. However, noisy signals can be difficult to analyze in the time domain, as shown below.

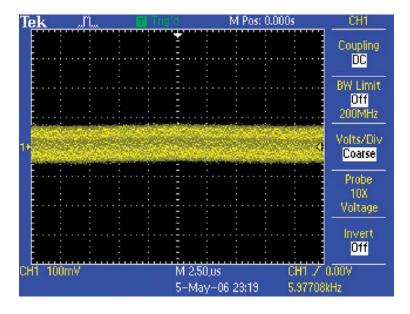

- Engineers and technicians can use the Fast Fourier Transform (FFT) to break down signals into component frequencies, which the oscilloscope uses to display a graph of the frequency domain of a signal, as opposed to the oscilloscope's standard time domain graph.
- Developers can then associate those frequencies with known system frequencies, such as system clocks, oscillators, read/write strobes, display signals, or switching power supplies.

Look for Unintentional Circuit Noise (continued)


The TDS2000C Series offers a standard FFT feature, making it an ideal tool for these identifying sources of noise in a circuit. To create FFT display:

Tek		Trigʻd	Pos: 25.	00MHz (CURSOR
					Type requency
				-	Source MATH
•					z 20.00MHz dB 5.20dB Cursor 1
		Hubits			0.00Hz - 36.6dB Cursor 2
CH1 10.0dB	5.00MHz			Ha	20.0MHz -31.4dB mning
		5-May	-06 23:21	6.07791kHz	

- 1. Press the front panel **MATH** button.
- 2. Press the **Operation** menu button until **FFT** is selected.
- 3. Press the **Window** menu button until the **Hanning** window is selected, which provides the highest frequency resolution.
- 4. If desired, use the vertical and horizontal **POSITION** and **SCALE** controls to magnify and position the FFT waveform.
- 5. Cursors can be used to accurately measure the FFT waveform. Press **CURSOR**.
- 6. Press the **Source** menu button until **MATH** is selected.
- 7. Press the Type menu button until Frequency is selected.
- 8. Press the **Cursor 1** menu button. Using the multipurpose knob, position cursor 1 at the left side of the display.
- 9. Press the **Cursor 2** menu button. Position cursor 2 on the highest point in the display.
- 10. The readout indicates one of the sources of noise. In this case, the 20 MHz signal is the system clock, which is coupling into the signal.

Power Line Harmonic Analysis

Power circuit designers often need to analyze the effects of their circuits on the power line. Although an ideal power supply would present a constant load on a power line, real power supply circuits

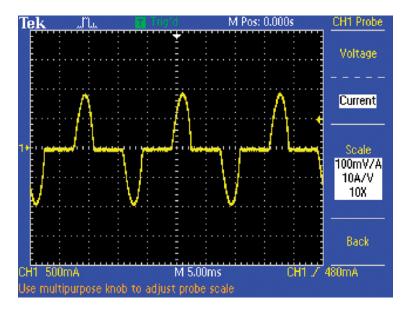


do not, creating harmonics on the power line. The TDS2000C provide simple tools to measure power supply currents and analyze the harmonics on a power line.

To display the power line harmonics on a current waveform:

- 1. Press the CH 1 MENU front panel button.
- 2. Press the Probe side menu button.
- 3. Press the **Current** side menu button to select current probe support.
- 4. Press the **Scale** side menu button to select the appropriate current probe scale factor.
- 5. Notice the readouts at the bottom of the display, where the waveform's vertical units are now in milliAmps (mA).
- 6. Press the **MATH** front panel button.
- 7. Press the **Operation** side menu button until **FFT** is selected.
- 8. Press the **Window** side menu button until **Flattop** is selected. This window is best for measuring amplitudes accurately.

Power Line Harmonic Analysis (continued)

The FFT display provides a frequency-domain display of the power line signal, including the fundamental power line frequency and the harmonics at integer multiples of the fundamental frequency. The

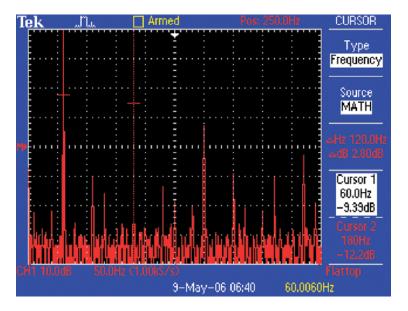


TDS2000C cursor measurements provide an easy and accurate way to analyze this complex display.

- 1. Press the **CURSOR** front panel button.
- 2. Press the **Source** side menu button until **MATH** is selected.
- 3. Press the Type side menu button until Frequency is selected.
- 4. Press the **Cursor 1** side menu button and use the multipurpose knob to align the cross-hair cursor on the left-most peak (the fundamental).
- 5. Press the **Cursor 2** side menu button and use the multipurpose knob to align the cross-hair cursor on the next-highest peak (the 3rd harmonic, in this case).
- 6. The readouts at the right of the screen indicated the absolute and relative frequencies and magnitudes.

Make a Quick Pass/Fail Test of Your Device

Design engineers doing validation test and debug or manufacturing engineers performing repetitive tests often need to compare live waveform signals against a know good reference signal. The TDS2000C offers quick pass/fail testing, also known as limit testing, by comparing active signals against a user defined template waveform. The oscilloscope can be set up to count both passing

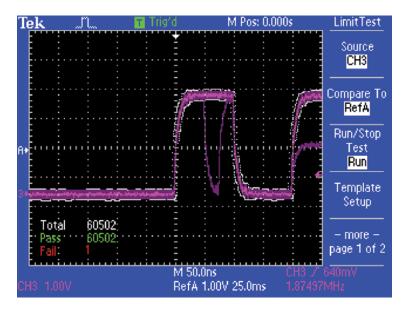


and failing waveforms. You can also set a user defined stop condition, including stop on manual control, elapsed time, waveform count, or waveform violations. When a failure condition occurs, the oscilloscope can be set to stop acquisition or save a screen image and/or waveform file to a USB device, enabling complete unattended operation.

To create a template for limit testing and perform a limit test:

- 1. Press the **Utility** front panel button.
- 2. Press the Limit Test side menu button to select Limit Test.
- 3. Press **Template Setup** side menu button to set up your template.
- 4. Set the vertical and horizontal limits of the template waveform.
- 5. Press **Apply Template** side menu button to store the limit test template.
- 6. Press the Stop side menu button to setup stop options.
- 7. Press **Action on Violation** side menu button to setup the action the oscilloscope should take when a violation occurs.
- 8. Press the Run/Stop Test side menu to start/stop the test.

Automatically Capture and Save Elusive Waveform Anomalies

Engineers often spend hours trying to capture specific events or waveform anomalies. The TDS2000C offers a data logging function that allows the oscilloscope to capture signals based on userspecified trigger conditions, Multiple triggered waveforms can be

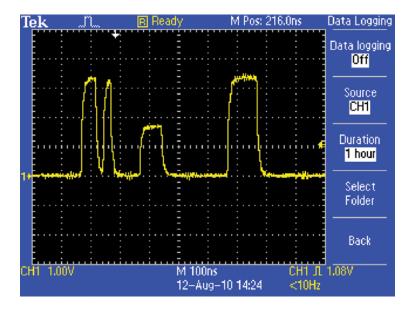


recorded based on user-defined time durations, selectable in 30 minute increments up to 8 hours of total time. Waveforms are time stamped and recorded to USB device and stored in CSV file format.

To use the data logging feature

- 1. Setup an appropriate trigger mode and acquisition mode.
- 2. Plug in your USB device to the oscilloscope's front-panel USB port.
- 3. Press the **Utility** front panel button.
- 4. Press the **Data Logging** side menu button to select the data logging function.
- 5. Setup the duration time from 30 minutes to 8 hours.
- 6. Press the Data Logging side menu button to start/stop the test.

Documenting Your Results with OpenChoice® Software

Design engineers in the lab and technicians in the field often need to document the work they do with their oscilloscope. They can save screen images to a removable memory device and then manually

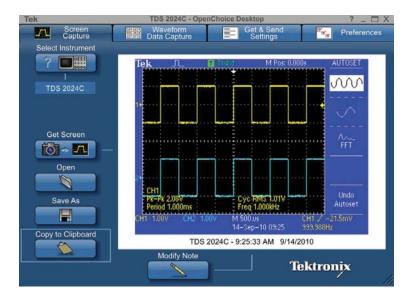

copy the files to their PC. The easy-to-use OpenChoice Desktop simplifies these documentation tasks by directly transferring screen images to your PC over USB.

- 1. Acquire the signal.
- 2. Connect the oscilloscope to the PC using a USB cable.
- 3. Launch the **OpenChoice Desktop** program.
- 4. Click **Select Instrument**, choose the correct USB instrument, and click **OK**.
- 5. Click Get Screen to capture the screen image.
- 6. Click **Save As** to save the screen image to a file on the PC.
- 7. Click **Copy to Clipboard**. You can then launch your documentation program and paste the image into the document.

Waveform Measurements Logging

A common task for engineers and technicians is to make measurements on their oscilloscope and then manually record measurements to document circuit performance variations over time.


r,	N 10 14 9.	ency (Ch1)															
	A B		D	E	F	6	н	1	J	к	L	M	N	0	P	Q	R
Fri	equency (Ch1)		0			v.,						140			1.0		
	1000.0000610362																
	999.9999389648																
1	1000.0101274414			1		_											
		Jun/13/95		1100													_
4		389 13/95	-(01.31.3	o mut													
4							-										
-1	1009.08						-										-
-1	1000.05						-				-						-
-1	1000.04		_														
-1	1000.02	-		A			-				-						-
1	1000 0 0001	NL	1	151													
-1		M	VV	1000	- Frequer	ncy (Ch1)						-					
-1	559.58	- W										-					-
1	199.95																+
-1	193.54																
-1							-										-
-1	109.92											-					-
	999.9			*******													
			102 24 24 1	37.40.41			L										
4	1 4 7 10 1	3 18 19 22 25															
l	1 4 7 10 1	3 16 19 22 25															
l	1 4 7 10 1	3 16 19 22 25				-						-	-				
	1 4 7 10 1	3 16 19 22 25]										
	1 4 7 10 1 999 9959309648 999 9660644531	3 16 19 22 25]			6	WI LINE		entruor 115	82-16.00	-874-(10)	10105-1	- 105
	1 4 7 10 1 999.999303648 999.9666644631 1000.0000610362	3 19 19 22 25]						epture - 115	NG- 16.89	-874-(30	10105-1	-105
1	1 4 7 16 1 999 9959309648 999 9660644531 1080 0000613362 999 9993289648	3 16 19 22 25					1				ek XI Alexen election Tree			121-1620-	-874(10	18105-1	-185
-	1 4 7 10 1 999.9959300648 999.9660644531 1000.0000613362 999.999309648 999.9999389648	3 14 19 22 25]				alaction Tim	ing Chartric			0874-110 Owrtusator		-NS
	1 4 7 16 1 999.9959300648 999.9960644531 1080.0000610362 999.9909389648 999.9999389648 999.9999389648	3 14 19 22 25]					ing Chartric					-145
A STATE OF	1 4 7 10 1 999 9909309648 999 9660644531 990 900013322 999 9999389648 996 903089648 996 9036425701	3 14 19 22 25]				alaction Tim	ing Chirtho		70	Owner	-	-145
the second se	1 4 7 16 1 999 990901648 999 9900444531 999 9900644532 999 999396968 999 99938968 996 99038968 996 99038968 996 9036425781 995 991530648	3 14 19 22 25					J				chartOyter ChartOyter	ing Ohiersing mi		70		-	-145
A STATE OF A	1 4 7 16 1 959 999303648 959 960644531 1960 0000610362 959 997305648 959 997305648 959 9230648 959 9230648 959 9230648 959 9530648	11 19 22 25									denten Tim Chart Option	ing Ohiersing mi			Owrtuscation F Active Sher		-145
Contraction of the second s	1 4 7 10 1 995 9959309640 999 9600644531 999 9600644531 996 9999389640 995 999319565 996 930427781 995 99133260336 996 930427781 995 9913326046 906 000610352	11 19 22 25					J				chartOyter ChartOyter	ing Ohiersing mi			Owner		-945.
Contraction of the second seco	1 4 7 10 1 999 9909300648 999 9900644531 1080 0000610362 999 999018648 999 999018648 999 90230648 999 90230648 1080 0155861055 1000 0000610352 990 99939991648	11 19 22 25					J				olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		-115
Contraction of the second s	1 4 7 10 1 999 999900644 999 9900644531 999 9900644531 999 9999109646 999 9909109646 999 9906560 999 9906560 999 9906560 999 9906056 990 990645 990 9909109646 999 999309646	11 9 22 25									chartOyter ChartOyter	eng Ohertho na rt cally			Owrtuscation F Active Sher		185
	1 4 7 10 1 999 9999300648 999 9909300648 999 9909044531 996 9909306445 996 9999309648 996 99523603386 996 9023603386 996 9023603386 906 0030610355 906 0030610355 906 0030610355 906 0030610355 906 0030610355 906 00306423781 906 0036423 906 0036423 906 0036423 906 0036423 906 0036423 906 003642 906 003642 906 003642 906 00364 906 0036 906 000 906 0036 906 0036 906 000 906 000 906 0006 906 000 90	11 9 22 25]				olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		- 86
	1 4 7 10 1 999.999900642 999.99090642 999.9909044531 999.990902644531 999.990920544 999.990920548 999.9902425781 999.990920648 999.990920645 999.990920645 999.990920644 999.990920644 999.990920644 999.990920644	11 9 22 25									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		-985
	1 4 7 10 1 999 90004421 999 90004421 999 990044231 999 990010342 999 99001044 999 90010342 999 90010442 999 9001055 900 000610352 999 909010442 900 000610352 999 909010448 900 000610352	11 9 22 25									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		- 945
	1 4 7 10 1 959 95920944 959 9500444271 959 9500444271 959 9500444271 959 959925944 959 959925944 959 95925945 959 95925944 959 95925944 959 95925944 959 95925944 959 95925944 959 95925844 959 959525781 959 959525781	11 9 22 25									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		96
	1 4 7 10 1 995 50050264451 996 500544451 996 5005044451 996 5005105446 996 5005105446 996 5005105446 996 5005105446 996 500510546 996 500510546 996 500510546 996 500510546 996 500510546 996 500510546 996 500510546	11 92.8									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		-945
	1 4 7 10 1 959 50020644 959 50020644 959 5002064451 960 5002641322 959 50020641322 959 5002064132 959 50224023791 959 50224023791 959 50224023791 959 50224023791 959 5022644 950 50020641332 959 50920644 950 50020641332 959 50920644 950 50020641332 959 50920644 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020642 950 50020641332 950 5002064132 950 50020641332 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 500206412 950 5002064 950 500 950	11 9228									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		-945
	1 4 7 10 1 999 505044231 999 505044231 999 505044231 999 505044231 999 505044231 999 5050442379 999 5050240336 999 5050240336 999 5050240336 999 5050240336 999 5050240379 999 505020541393 999 505020641393 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 505006 999 505006 999 505006 999 5050 999 505006 999 505006 999 505006 990 50006 990 50006 900 50006 900 50006 900 50006 900 50006 900 50006 900 50006 900 50006 900 5000 900 5000 900 5000 900 5000 900 5000 900 500 900 500 900 500 900 500 900 500 900 500 900 500 900 900 500 900 900 900 500 900 900 500 900 900 9	11 9220									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		-NS
	1 4 7 10 1 959 50020644 959 50020644 959 5002064451 960 5002641322 959 50020641322 959 5002064132 959 50224023791 959 50224023791 959 50224023791 959 50224023791 959 5022644 950 50020641332 959 50920644 950 50020641332 959 50920644 950 50020641332 959 50920644 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020641332 950 50020642 950 50020641332 950 5002064132 950 50020641332 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 5002064132 950 500206412 950 5002064 950 500 950	11 9220]				olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		- 246
	1 4 7 10 1 999 505044231 999 505044231 999 505044231 999 505044231 999 505044231 999 5050442379 999 5050240336 999 5050240336 999 5050240336 999 5050240336 999 5050240379 999 505020541393 999 505020641393 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 5050064139 999 505006 999 505006 999 505006 999 5050 999 505006 999 505006 999 505006 990 50006 990 50006 900 50006 900 50006 900 50006 900 50006 900 50006 900 50006 900 50006 900 5000 900 5000 900 5000 900 5000 900 5000 900 500 900 500 900 500 900 500 900 500 900 500 900 500 900 900 500 900 900 900 500 900 900 500 900 900 9	111 11 12 12									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally			Owrtuscation F Active Sher		945
	1 4 7 10 1 995 900044831 995 900044831 995 900044331 995 900044331 995 900044331 996 900031944 996 900309444 996 900309444 996 900309444 996 90030944332 996 900309444 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90030944332 996 90040944332 996 90040944332 996 90040944332 996 90040944332 996 90040944332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 9004044332 996 90044432 996 9004044332 996 90044432 996 900443 996 900443 996 900443 996 900443 996 90044 996 90044 996 90044 996 900 996 9004 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 900 996 996 900 996 996 996 996 996 996 996 996 996	11 9220									olection Tee OvertOpter C No char C Pariodo	eng Ohertho na rt cally	0		Owrtuscation F Active Sher		- 240
	1 4 7 10 1 995 505044531 995 505044531 995 505044531 995 505044531 995 505044531 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 50214545 995 5021455 995 5021455 995 502145 995 502145 995 502145 995 502145 995 502145 995 502145 995 502145 995 50214 995 50214 995 5021 995 5021 995 5021 995 5021 995 5021 995 5021 995 5021 995 502 995 995 502 995 50 995 502 995 502 995 50 995 50 995 50 995 50 995 50 995 50 995 50	11 9220									olecten Twe Ourt Opter I No dhar I No dhar I Norder I Liben G	wy Ohetho re rt cally Conpieton	0		OurtLocator Active Sheet ^(*) New Sheet	et .	1945
	1 4 7 10 1 959 50900044 959 509044531 959 509044531 959 509044531 959 509044531 959 509044531 959 509030544 959 50903054 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090305 959 5090 959 5090305 959 5090305 959 5090 959 5090 959 5090305 959 5090 959 5090305 959 5090 959 5090305 959 5090 959 959 5090 959 509 959 509 959 5090 959 509 959 50	11 9220									olection Tee OvertOpter C No char C Pariodo	wy Ohetho re rt cally Conpieton			Owrtuscation F Active Sher	et .	945

However, this is time-consuming and can lead to inconsistent quality of documentation. The easy-to-use TekXL toolbar simplifies data gathering and documentation tasks inside Excel.

- 1 Acquire the signal.
- 2. Connect the oscilloscope to the PC using a USB cable.
- Launch Excel and enable the TekXL toolbar by selecting Tools > Add-ins... and checking the box next to TekxItoolbar.
- 4. Press the **TekXL Connection** icon, select the desired instrument, and press OK.
- 5. Press the TekXL Measurements icon.
- 6. On the Selection tab, choose **Frequency**.
- 7. On the Timing tab, select 45 samples.
- 8. On the Charting tab, choose Upon Completion.

Waveform Analysis Using NI SignalExpress[™] Tektronix Edition Software

Although the TDS2000C provide significant on-board analysis capabilities, there are applications where the analysis requirements are better met with PC-based applications. SignalExpress Tektronix

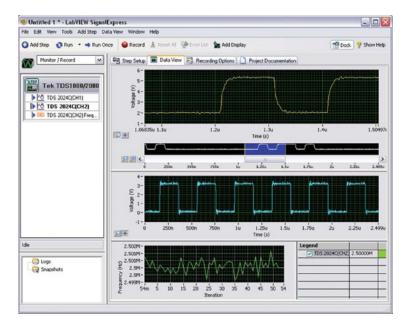

Edition provides advanced analysis capabilities with the ease of USB plug-and-play.

- 1. Acquire the signal.
- 2. Connect the oscilloscope to the PC using a USB cable.
- 3. Launch the SignalExpress TE program.
- 4. SignalExpress will open with the instrument automatically connected and transferring data to the PC.
- 5. To conduct a limit test of the signal against specified limits, select Add Step > Analog > Test Limit > Test.
- 6. To display the histogram of the signal, select Add Step > Analog > Time-Domain Measurements > Histogram.

Contact Tektronix: ASEAN / Australasia (65) 6356 3900 Austria* 00800 2255 4835 Balkans, Israel, South Africa and other ISE Countries +41 52 675 3777 Belgium* 00800 2255 4835 Brazil +55 (11) 3759 7600 Canada 1 (800) 833-9200 Central East Europe, Ukraine and the Baltics +41 52 675 3777 Central Europe & Greece +41 52 675 3777 Denmark +45 80 88 1401 Finland +41 52 675 3777 France* 00800 2255 4835 Germany* 00800 2255 4835 Hong Kong 400-820-5835 India 000-800-650-1835 Italy* 00800 2255 4835 Japan 81 (3) 6714-3010 Luxembourg +41 52 675 3777 Mexico, Central/South America & Caribbean 52 (55) 56 04 50 90 Middle East. Asia and North Africa +41 52 675 3777 The Netherlands* 00800 2255 4835 Norway 800 16098 People's Republic of China 400-820-5835 **Poland** +41 52 675 3777 Portugal 80 08 12370 Republic of Korea 001-800-8255-2835 Russia & CIS +7 (495) 7484900 South Africa +27 11 206 8360 Spain* 00800 2255 4835 Sweden* 00800 2255 4835 Switzerland* 00800 2255 4835 Taiwan 886 (2) 2722-9622 United Kingdom & Ireland* 00800 2255 4835 USA 1 (800) 833-9200 * If the European phone number above is not accessible, please call: +41 52 675 3777

Contact List Updated 25 May 2010

Copyright © 2010, Tektronix. All rights reserved. Tektronix products are covered by U.S. and foreign patents, issued and pending. Information in this publication supersedes that in all previously published material. Specification and price change privileges reserved. TEKTRONIX and TEK are registered trademarks of Tektronix, Inc. All other trade names referenced are the service marks, trademarks or registered trademarks of their respective companies.



9/10 EA/WWW 3GW-19696-2